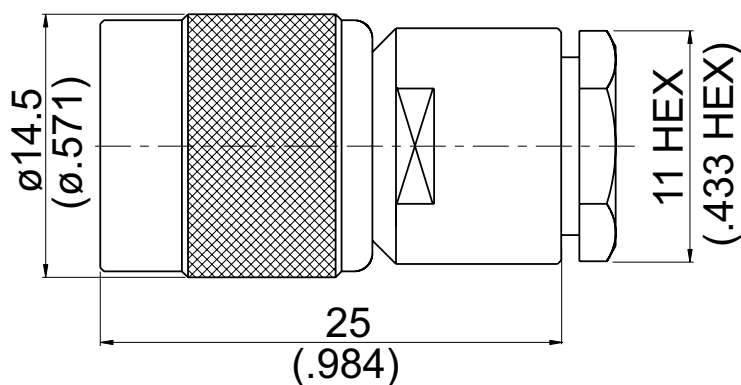


TNC3200B-0058

TNC Plug Clamp

50Ω



Parts	Material	Plating (Micro-inch)
Hex Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Brass	Gold 3 Over Nickel 50 Over Copper 50
Gasket	Silicon	
Ring	Delrin	
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight: 17.54 g

Suitable Cables: RG58, JBY195, RG55, RG142, RG400, RG142-E

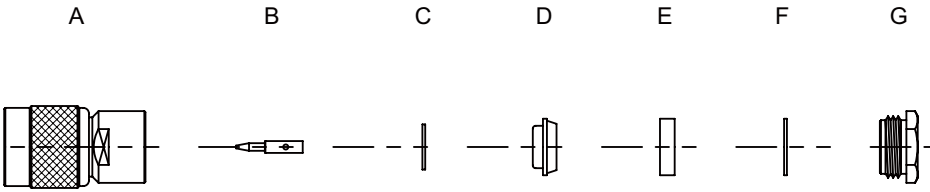
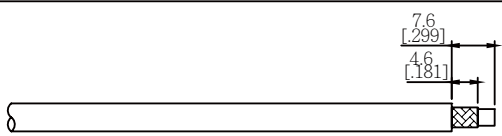
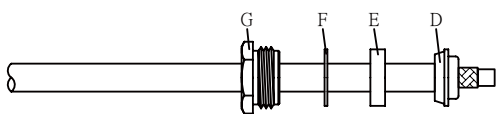
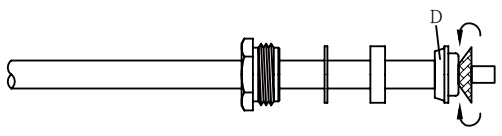
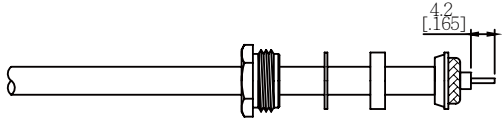
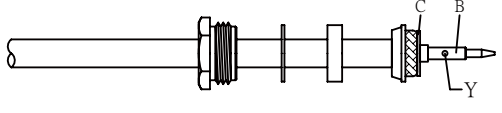
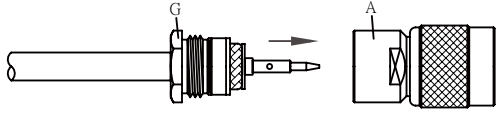
This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

TNC3200B-0058

JYE BAO CO., LTD.

TNC3200B-0058	DATE	2014/04/29	REV	—			
	A	B	C	D	E	F	G
BODY	CONTACT PIN	WASHER	BRAID CLAMP	GASKET	WASHER	NUT	
DIAGRAM	ASSEMBLY INSTRUCTION						
	Step 1: STRIP AS SHOWN.						
	Step 2: SLIDE NUT " G "、WASHER " F "、GASKET " E " AND BRAID CLAMP " D " OVER CABLE.						
	Step 3: WRAP THE BRAIDING OVER " D ".						
	Step 4: STRIP AS SHOWN.						
	Step 5: SLIDE PREPARED CABLE INTO WASHER " C ". Step 6: PUT CONTACT PIN " B " ON CENTER CONDUCTOR AND SOLDER OR CRIMP IN " Y ". (USE SQUARE 1.6mm/0.063inch SECTION OF INSERT-A IF CRIMPED)						
	Step 7: FINALLY SCREW " G " ON THE CONNECTOR BODY " A ".						

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.